Datasheet



### XENSIV<sup>™</sup> PAS CO2 5 V sensor based on photo acoustic spectroscopy principle

#### Features

- Operating range: 0 ppm to 32000 ppm
- Accuracy: ±50 ppm ±5% of reading between 400 ppm and 3000 ppm
- Lifetime: 10 years for indoor mission profile
- Interface: I<sup>2</sup>C, UART, and PWM
- Package dimension: 13.8 × 14 × 7.5 mm<sup>3</sup>
- Maintenance: Maintenance-free when using ABOC feature (automatic baseline offset correction)

#### **Potential applications**

High accuracy, compact size, and SMD capability make the XENSIV<sup>™</sup> PAS CO2 sensor ideal for indoor air quality monitoring solutions in the market with numerous potential applications.

- HVAC (heating, ventilation, air conditioning)
- Home appliances
- Smart home IoT devices
- In-cabin air quality monitoring unit
- Agriculture/greenhouses

#### Description

Infineon has leveraged its knowledge in sensors and MEMS technologies to develop a disruptive gas sensor for CO<sub>2</sub> sensing. The XENSIV<sup>™</sup> PAS CO2 is a real CO<sub>2</sub> sensor combining NDIR technology with Infineon's high SNR MEMS microphones, allowing for state-of-the-art accuracy in an exceptionally small form factor.

The sensor is based on the photoacoustic spectroscopy (PAS) principle, where CO<sub>2</sub> molecules within the sensor cavity absorb infrared light, generating small pressure changes that are detected by an acoustic detector. CO<sub>2</sub> concentration is then delivered in the form of a direct ppm readout, thanks to the integrated microcontroller. Highly accurate CO<sub>2</sub> readings are guaranteed.

OPN number	Package	SP number
PASCO2V15AUMA1	LG-MLGA-14-2	SP005862398





## PASCO2V15

Datasheet

Table of contents



## **Table of contents**

	Features
	Potential applications
	Description
	Table of contents    2
1	Block diagram
2	<b>Pin-out diagram</b>
3	<b>Typical sensor response to CO<sub>2</sub> concentration change</b> 6
4	Characteristics and parameters
4.1	Specification
4.1.1	Operating range
4.1.2	Storage conditions
4.1.3	Timing characteristics
4.1.4	Absolute maximum ratings
4.1.5	Current rating and power consumption 10
4.1.6	CO <sub>2</sub> transfer function
4.2	Digital interfaces
4.2.1	I <sup>2</sup> C interface
4.2.1.1	I <sup>2</sup> C transaction format
4.2.1.2	I <sup>2</sup> C timing characteristics
4.2.2	UART interface
4.3	Application circuit examples
4.3.1	I <sup>2</sup> C application circuit example
4.3.2	UART application circuit example
4.3.3	PWM application circuit example
4.4	Functional description
4.4.1	Operating modes
4.4.2	Data post-processing
4.4.2.1	Pressure compensation
4.4.2.2	Automatic baseline offset correction17
4.4.2.3	Forced compensation
4.4.2.4	Alarm threshold
4.5	Monitoring mechanism as advanced functionality18
5	<b>Register map</b>
5.1	Register map access method    19
5.2	Register map bitfields
5.3	Product and revision ID register (PROD_ID)21
5.4	Sensor status register (SENS_STS)




Table of contents

5.5	Measurement period configuration registers (MEAS_RATE_H)	23
5.6	Measurement period configuration registers (MEAS_RATE_L)	
5.7	Measurement mode configuration register (MEAS_CFG)	24
5.8	CO <sub>2</sub> concentration result register (CO2PPM_H)	
5.9	CO <sub>2</sub> concentration result register (CO2PPM_L)	26
5.10	Measurement status register (MEAS_STS)	
5.11	Interrupt pin configuration register (INT_CFG)	27
5.12	Alarm threshold register (ALARM_TH_H)	28
5.13	Alarm threshold register (ALARM_TH_L)	
5.14	Pressure compensation registers (PRES_REF_H)	29
5.15	Pressure compensation registers (PRES_REF_L)	30
5.16	Automatic baseline offset compensation reference (CALIB_REF_H)	30
5.17	Automatic baseline offset compensation reference (CALIB_REF_L)	
5.18	Scratch pad register (SCRATCH_PAD)	31
5.19	Soft reset register (SENS_RST)	32
6	Assembly instruction	33
7	Package dimensions and footprint	
8	Packing for shipment	35
	Revision history	36
	Disclaimer	

1 Block diagram





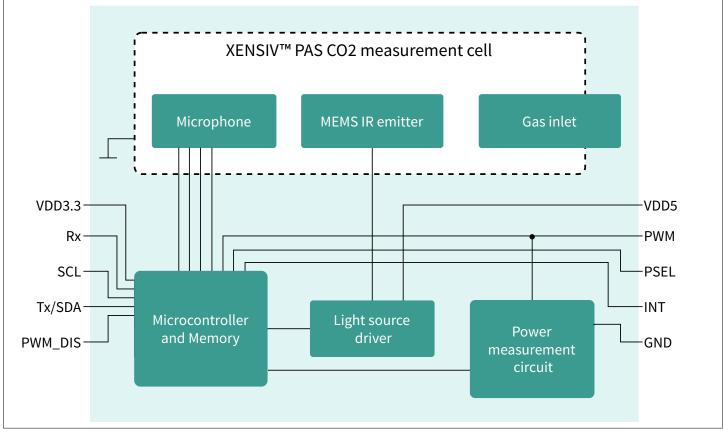



Block diagram of XENSIV<sup>™</sup> PAS CO2

2 Pin-out diagram





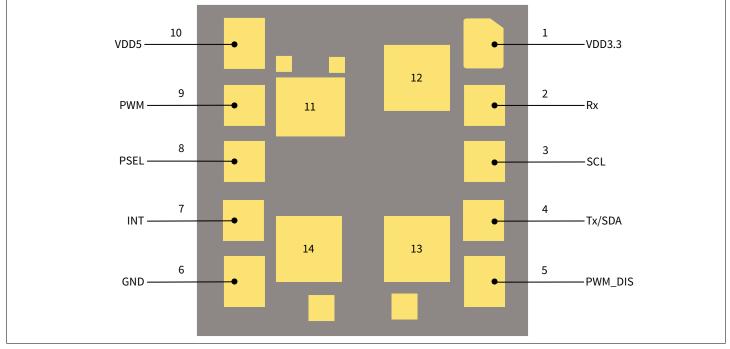


Figure 2

Pin-out diagram (bottom view)

### Table 1Pin description


PIN	Symbol	Туре	Description			
1	VDD3.3	Power supply (3.3 V)	3.3 V digital power supply			
2	Rx	Input/output	UART receiver pin (3.3 V domain)			
3	SCL	Input/output	I <sup>2</sup> C clock pin (3.3 V domain)			
4	Tx/SDA	Output	UART transmitter pin (3.3 V domain)/I <sup>2</sup> C data pin (3.3 domain)			
5	PWM_DIS	Input	PWM disable input pin (3.3 V domain)			
6	GND	Ground	Ground			
7	INT	Output	Interrupt output pin (3.3 V domain)			
8	PSEL	Input	Communication interface select input pin (3.3 V doma			
9	PWM	Output	PWM output pin (3.3 V domain)			
10	VDD5	Power supply (5 V)	5 V power supply for the IR emitter			



3 Typical sensor response to CO<sub>2</sub> concentration change

# 3 Typical sensor response to CO<sub>2</sub> concentration change

Measurement condition: VDD5 = 5.0 V, VDD3.3 = 3.3 V,  $T_{amb}$  = 25°C, p = 1013 hPa and % r.H. = 30%

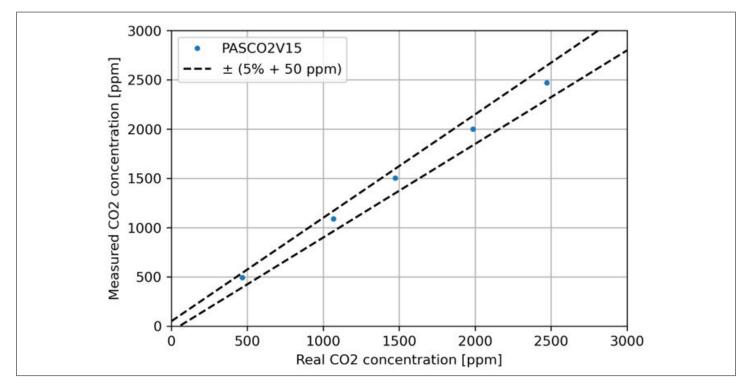



Typical sensor response to CO<sub>2</sub> concentration change



## 4 Characteristics and parameters

## 4.1 Specification

### 4.1.1 Operating range

To ensure proper operation of the sensor, the following operating conditions must not be exceeded. All parameters specified in the subsequent sections refer to these operating conditions unless otherwise specified.

Parameter	Symbol	Values	5		Unit	Note or test condition
		Min.	Тур.	Max.		
CO <sub>2</sub> measurement range <sup>1)</sup>	C <sub>CO2</sub>	0		32000	ppm	Functional measurement range
Ambient temperature <sup>1)</sup>	T <sub>amb</sub>	0		50	°C	
Relative humidity <sup>1)</sup>	rH	0		85	%	Non-condensing
Pressure <sup>1)</sup>	p	750	1013	1150	hPa	
Supply voltage <sup>1)</sup>	VDD3.3	3	3.3	3.6	V	
	VDD5	4.45	5	5.5	V	
Lifetime <sup>1)</sup>	t <sub>life</sub>		10		Year	Depends on mission profile

1) Not subject to production test. This parameter is verified by design/characterization.

## 4.1.2 Storage conditions

Storage condition refers to dry pack: packed, evacuated, desiccant<sup>1)</sup>, humidity indicator card (HIC) sealed moisture barrier bag.

### Table 3Storage condition

Parameter	Symbol	Values			Unit	Note or test condition
		Min.	Тур.	Max.		
Storage temperature <sup>1)</sup>	T <sub>storage</sub>	5		40	°C	<90% r.H. <sup>2)</sup>
Storage time <sup>1)</sup>	t <sub>storage</sub>			3	Year	
Storage temperature during transport <sup>1)</sup>	T <sub>storage_transport</sub>	-20		60	°C	
Storage time during transport <sup>1)</sup>	t <sub>storage_transport</sub>			10	Day	

1) Not subject to production test. This parameter is verified by design/characterization.

2) Condensation and bedewing shall be avoided.

1

Number of desiccant units to be calculated according to JEDEC Standard 033.

infineon

4 Characteristics and parameters

# 4.1.3 Timing characteristics

### Table 4Timing characteristics


Parameter	Symbol	Values			Unit	Note or test condition	
		Min.	Тур.	Max.			
Sampling time <sup>1)</sup>	t <sub>sampling</sub>	10	60	4095	S	Sensor accuracy may be affected when sampling rates exceed 1 meas/min	
Time to sensor ready <sup>1)</sup>	t <sub>sensor_rdy</sub>			1	s		
Time to early notification <sup>1) 2)</sup>	t <sub>early_noti</sub>		2		S		
I <sup>2</sup> C clock frequency <sup>1)</sup>	f <sub>I2C</sub>		100		kHz		
			400				
PWM frequency <sup>1)</sup>	f <sub>pwm</sub>		80		Hz		
UART baud rate <sup>1)</sup>	f <sub>baud</sub>		9.6		kbps		

1) Not subject to production test. This parameter is verified by design/characterization.

2) Relevant for continuous mode of operation.



4 Characteristics and parameters

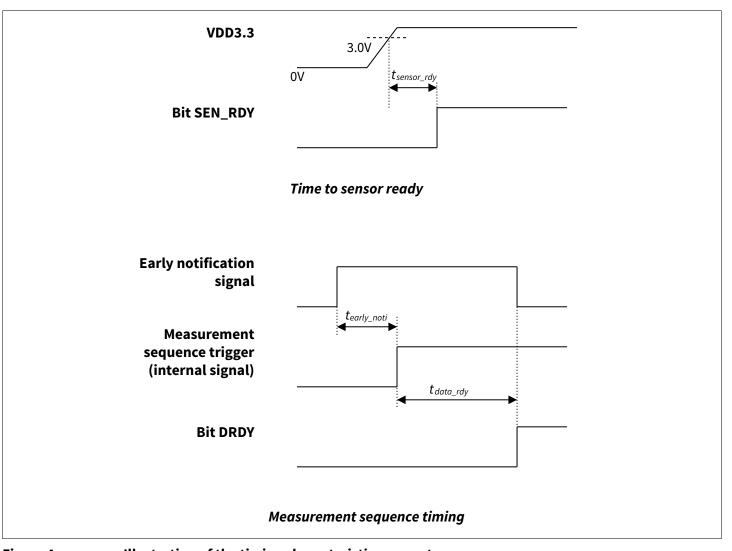

Typical measurement timing sequence for I<sup>2</sup>C and UART is presented in Figure 4.

Figure 4

Illustration of the timing characteristic parameters

PASCO2V15 Datasheet

## 4.1.4 Absolute maximum ratings

#### Table 5 Absolute maximum ratings

Parameter	Symbol	Values			Unit	Note or test condition
		Min.	Тур.	Max.		
MSL level	MSL		3			
Maximum ambient temperature	T <sub>amb_max</sub>	-10		60	°C	
Maximum relative humidity	rH <sub>max</sub>	0		95	%	
5 V supply voltage	V <sub>VDD5</sub>	4.45		5.5	V	
3.3 V supply voltage	V <sub>VDD3.3</sub>	3.0		3.6	V	
Reflow temperature	T <sub>r</sub>			245	°C	JEDEC J-STD-020E
ESD human body model	V <sub>ESD_HBM</sub>	-2		2	kV	HBM (JS001)
ESD charge discharge model	V <sub>ESD_CDM</sub>			500	V	CDM (JS002)

*Note:* Stresses above the values listed as "Absolute Maximum Ratings" may cause permanent damage to the devices. Exposure to absolute maximum rating conditions for extended period of time may affect device reliability.

## 4.1.5 Current rating and power consumption

**Current rating** 

All parameters specified in Table 5 refer to the following operating conditions unless otherwise specified: VDD3.3 = 3.3 V, VDD5 = 5.0 V,  $T_{amb} = 25^{\circ}$ C, % r.H. = 30%, p = 1013 hPa.

Parameter	Symbol	Pin	Value	s		Unit	Note or test condition
			Min. Typ. Max.				
Peak current <sup>1)</sup>	I <sub>peak 5</sub>	VDD5		265	290	mA	
Peak current <sup>1)</sup>	I <sub>peak 3.3</sub>	VDD3.3		10		mA	
Average current <sup>1)</sup>	I <sub>avg 5</sub>	VDD5		1		mA	At 1 meas/min
Average current <sup>1)</sup>	I <sub>avg 3.3</sub>	VDD3.3		10		mA	At 1 meas/min
Average power <sup>1)</sup>	Pavg			30		mW	At 1 meas/min

1) Not subject to production test. This parameter is verified by design/characterization.

Table 6

PASCO2V15 Datasheet

\_ . . \_

## 4.1.6 CO<sub>2</sub> transfer function

.

All parameters specified in the following sections refer to the operating conditions unless otherwise specified: VDD3.3 = 3.3 V, VDD5 = 5.0 V,  $T_{amb}$  = 25°C, % r.H. = 30%, p = 1013 hPa, and  $t_{sampling}$  = 1 meas/min.

Parameter	Symbol	Values		Unit	Note or test condition	
		Min.	Тур.	Max.		
Accuracy <sup>1)</sup>	Acc	-50 ppm -5% of reading		+50 ppm +5% of reading	ppm	С <sub>СО2</sub> : 400-3000 ррт
Response time <sup>2)</sup>	t <sub>63</sub>		55		s	
Repeatability <sup>2) 3)</sup>	R			10	ppm	
Pressure stability <sup>2)</sup>	<i>p</i> <sub>error</sub>		0		%/hPa	With pressure compensation feature enabled
Acoustic stability <sup>2)</sup>	SPL <sub>error</sub>	3	6	15	ppm	Up to 95 dB for pink noise from 100 Hz to 10 kHz

 Accuracy verified using certified calibration gas mixtures and high-precision reference sensors. Uncertainty in calibration gas mixtures of ±2% needs to be considered. Temporary deviations in accuracy caused by assembly, rough handling or harsh environmental conditions can be compensated using forced compensation scheme (FCS) or automatic baseline offset correction (ABOC).

2) Not subject to production test. This parameter is verified by design/characterization.

3) Stepwise Reaction IIR filter is enabled.

## 4.2 Digital interfaces

The XENSIV<sup>™</sup> PAS CO2 supports I<sup>2</sup>C, UART, and PWM. The I<sup>2</sup>C and UART interfaces are described in detail in the following chapters.

## 4.2.1 I<sup>2</sup>C interface

The device complies with the I<sup>2</sup>C protocol. When I<sup>2</sup>C is selected as a serial communication interface, the device acts as an I<sup>2</sup>C slave. The main characteristics of the interface are described below:


- Slave mode only
- I<sup>2</sup>C clock frequency: 100 kHz and 400 kHz
- 7-bit slave address: 0×28
- No CRC
- The device supports clock stretching
- 8-bit addressing mode supported (7-bit address + RW)
- Bulk read and write supported (device auto-increments automatically the address)
- Address 0×00 not supported

Further details of the protocol are covered in the separate application note.



## 4.2.1.1 I<sup>2</sup>C transaction format

The I<sup>2</sup>C transaction has the following structure: a start condition followed by four bytes followed a stop condition.

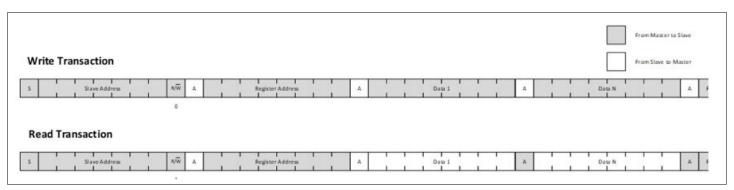

#### Figure 5 I<sup>2</sup>C write and read transaction

Byte	Description	Value	Comments
	Start condition		
1	Header	(Slave address << 1)   R/W	
2	First data-byte	As per user request/register value	Read: data provided by the slave Write: data provided by the user
N+2	Data byte N	As per user request/register value	Read: data provided by the slave Write: data provided by the user
	End condition		

## 4.2.1.2 I<sup>2</sup>C timing characteristics

Due to the wired-AND configuration of an I<sup>2</sup>C bus system, the port drivers on the SCL and SDA signal lines need to operate in open-drain mode. The high level of these lines must be held by an external pull-up device, approximately 10 kOhm for operation at 100 kbits/s, approximately 2 kOhm for operation at 400 kbits/s.

### Table 9I<sup>2</sup>C standard mode timing

Parameter	Symbol	Values			Unit	Note or test condition	
		Min.	n. Typ.	Max.			
Fall time of both SDA and SCL	t1			300	ns		
Rise time of both SDA and SCL	t2			1000	ns		
Data hold time	t3	0			μs		
Data set-up time	t4	250			ns		
LOW period of SCL clock	t5	4.7			μs		
HIGH period of SCL clock	t6	4.0			μs		
Hold time for a (repeated) START condition	t7	4.0			μs		
Set-up time for (repeated) START condition	t8	4.7			μs		

```
(table continues...)
```



4 Characteristics and parameters

## Table 9 (continued) I<sup>2</sup>C standard mode timing


Parameter	Symbol	Values			Unit	Note or test condition	
		Min.	Тур.	Max.			
Set-up time for STOP condition	t9	4.0			μs		
Bus free time between a STOP and START condition	t10	4.7			μs		
Capacitive load for each bus line	Cb			400	pF		

### Table 10I<sup>2</sup>C fast mode timing

Parameter	Symbol	Values			Unit	Note or test condition	
		Min. Typ. I		Max.			
Fall time of both SDA and SCL	t1	20 + 0.1*C <sub>b</sub>		300	ns	C <sub>b</sub> refers to the total capacitance of one bus line in pF	
Rise time of both SDA and SCL	t2	20 + 0.1*C <sub>b</sub>		300	ns	C <sub>b</sub> refers to the total capacitance of one bus line in pF	
Data hold time	t3	0			μs		
Data set-up time	t4	100			ns		
LOW period of SCL clock	t5	1.3			μs		
HIGH period of SCL clock	t6	0.6			μs		
Hold time for a (repeated) START condition	t7	0.6			μs		
Set-up time for (repeated) START condition	t8	0.6			μs		
Set-up time for STOP condition	t9	0.6			μs		
Bus free time between a STOP and START condition	t10	1.3			μs		
Capacitive load for each bus line	C <sub>b</sub>			400	pF		

4 Characteristics and parameters



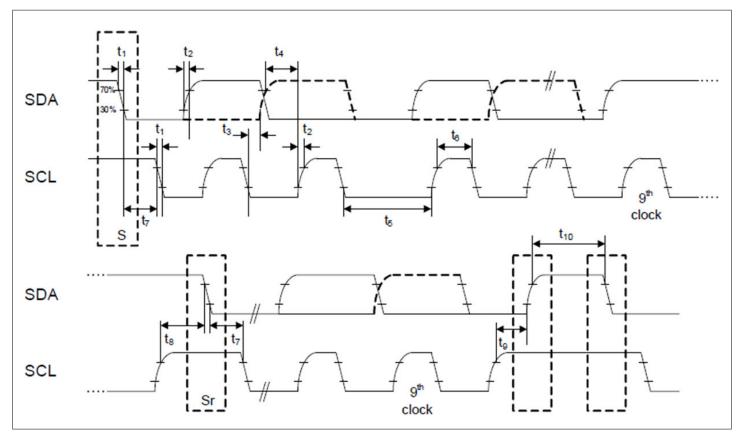



## 4.2.2 UART interface

When UART is selected as a serial communication interface, the device acts as a UART slave. The device operates via UART for point-to-point communication. Bus operation is not supported. As a result, it is recommended that the master uses a time-out mechanism. The basic format of a valid UART frame is 1 start bit, 8 data bits, no parity bit, and 1 stop bit. The master combines several UART frames into a message (read or write). The combination of master request and slave answer defines a transaction. The main characteristics of the interface are described below:

- Point to point operation no bus support
- Slave operation only
- UART clock frequency = 9.6 kHz
- Format: 1 start bit, 8 data bits, no parity bit, 1 stop bit. Supports direct connection with a terminal program



PASCO2V15 Datasheet

## 4.3 Application circuit examples

## 4.3.1 I<sup>2</sup>C application circuit example


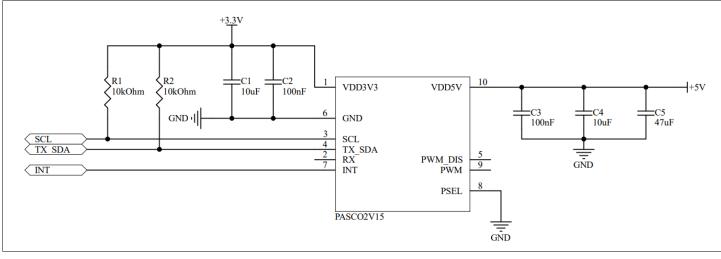


Figure 7 Application circuit example for I<sup>2</sup>C

With this configuration, the device will start in Idle mode of operation. Internal pull up is present on PWM\_DIS pin.

## 4.3.2 UART application circuit example



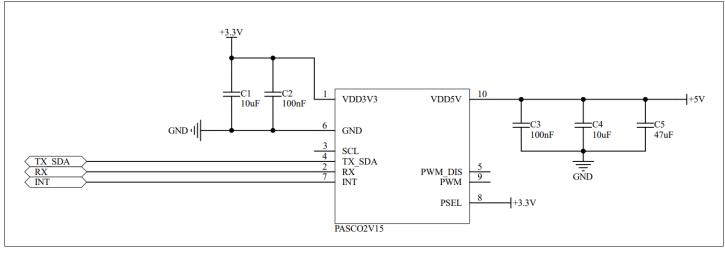


With this configuration, the device will start in Idle mode of operation. Internal pull up is present on PWM\_DIS pin.

infineon

4 Characteristics and parameters

## 4.3.3 PWM application circuit example

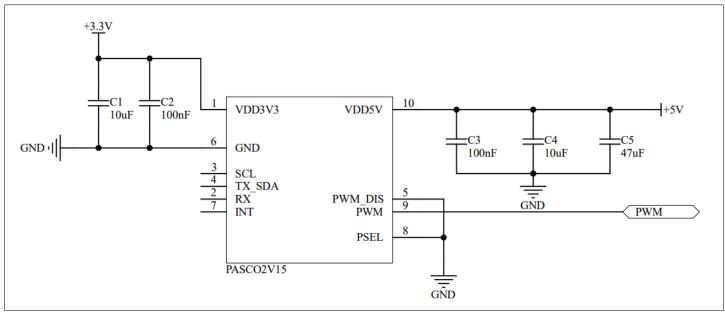

### Figure 9 Application circuit example for PWM

With this configuration, the device will start in continuous mode of operation with sampling time of 1 meas/min.

## 4.4 Functional description

This section describes the operation of the sensor while measuring CO<sub>2</sub> concentrations. At any moment, the device can be in one out of two different states: active and inactive. At active state, the CPU controlling the device is operating and can perform tasks, such as: running a measurement sequence, serving an interrupt, and so on. When the device has no specific task to perform, it goes to an inactive state. A transition from active to inactive state may occur at the end of a measurement sequence. Several events can wake up the device: the reception of a measurement request in continuous measurement mode.

## 4.4.1 Operating modes


The operating mode can be programmed via the serial communication interface by using the bit field **MEAS\_CFG.OP\_MODE**.

The sensor module supports three operating modes:

- **Idle mode:** The device does not perform any CO<sub>2</sub> concentration measurement. The device remains inactive until it becomes active shortly to serve interrupts before going back to an inactive state
- Continuous mode: In this mode, the device periodically triggers a CO<sub>2</sub> concentration measurement sequence.
   Once a measurement sequence is completed, the device goes back to an inactive state and wakes up automatically for the next measurement sequence. The measurement period is programmable from 5 s to 4095 s
- **Single-shot mode:** In this mode, the device triggers a single measurement sequence. At the end of the measurement sequence, the device goes back automatically to idle mode



4 Characteristics and parameters

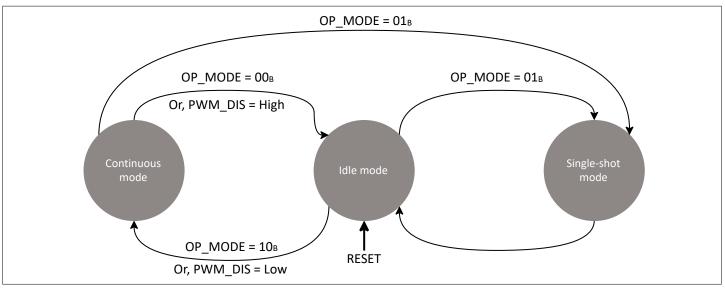



## 4.4.2 Data post-processing

Once the CO<sub>2</sub> concentration data has been acquired, several post-processing schemes can be applied to utilize different functionality.

## 4.4.2.1 Pressure compensation

The CO<sub>2</sub> concentration value acquired by the sensor is dependent on the external atmospheric pressure. To compensate for this effect, the application system can provide the value of the atmospheric pressure by writing into the specific registers, that is, **PRES\_REF\_H** and **PRES\_REF\_L**. At the end of a measurement sequence, the device reads the pressure value and applies for compensation on the CO<sub>2</sub> concentration value before storing it into the result registers.

## 4.4.2.2 Automatic baseline offset correction

To correct slow drifts caused by aging during operation, the device supports automatic baseline offset compensation. Every week of operation, the device computes an offset to correct the baseline of the device. The device must be in contact with the reference concentration (for example, fresh air at 400 ppm of CO<sub>2</sub> concentration) at least 30 minutes per operating week to make sure proper baseline compensation. The device supports different configurations for compensation. The ABOC set point may only be set between 350 and 1500 ppm.

## 4.4.2.3 Forced compensation

Forced compensation provides a means to speed up the offset compensation process. Before forced compensation is enabled, the device shall be physically exposed to the reference  $CO_2$  concentration. The device will use the next three measurements to calculate the compensation offset. The user shall ensure constant exposure to the reference  $CO_2$  concentration during that time. It is recommended to operate at one measurement per 10 seconds while implementing the forced compensation scheme. When three measurement sequences are completed, the device automatically reconfigures itself with the newly computed offset applied to the subsequent  $CO_2$  concentration measurement results. The forced compensation offset can be stored to the non-volatile memory by using the corresponding command (SENS\_RST = 0xCF).

infineon

4 Characteristics and parameters

## 4.4.2.4 Alarm threshold

The device can be configured via interrupt to perform an alarm threshold check each time a new CO<sub>2</sub> concentration data is acquired. At the end of each measurement sequence, the computed CO<sub>2</sub> value (after all applicable offset compensations) is compared to the concatenated value in **ALARM\_TH\_H** and **ALARM\_TH\_L**. In case of a threshold violation, the sticky bit **MEAS\_STS.ALARM** is set. This also sets pin **INT** to active level due to configuration as alarm. Bit **MEAS\_STS.ALARM** is cleared by reading register **MEAS\_STS.ALARM\_CLR**.

## 4.5 Monitoring mechanism as advanced functionality

The device supports several mechanisms to monitor the correct operation of the sensor.

Mechanism	Description					
Sensor ready status	After each power-on reset, bit <b>SENS_STS.SEN_RDY</b> is set to confirm that the sensor has initialized correctly					
Scratchpad register	<ul> <li>To check the integrity of the communication layer of the serial communication interface, register SCRATCH_PAD can be used. This register can use this memory field to write any value and verify that the data received by the device is correct. It can also be used to verify that a soft reset has been executed, using the following sequence:</li> <li>1. The user writes a non-default value to register SCRATCH_PAD</li> <li>2. The user reads back register SCRATCH_PAD to verify the writ commend has been correctly executed</li> <li>3. The user writes register SENS_RST to trigger a soft reset</li> <li>4. The user reads register SCRATCH_PAD to verify that it has been reset to its default value</li> </ul>					
VDD5V verification	At power-up and the beginning of each measurement sequence, the device automatically measures the voltage at VDD5. If the measured voltage exceeds the specified operating range of the device, bit SENS_STS.ORVS is set. The measurement sequence is, however, completed normally. Bit SENS_STS.ORVS can be cleared by setting bit SENS_STS.ORVS_CLR					
Internal temperature verification	At the beginning of each measurement sequence, the device automatically measures its internal temperature. If the measured temperature exceeds the specified operating ranged of the device, sticky bit <b>SENS_STS.ORTMP</b> is set. The measurement sequence is, however, completed normally. Bit <b>SENS_STS.ORTMP</b> can be cleared by setting bit <b>SENS_STS.ORTMP_CLR</b>					

### Table 11 Functionality description

Datasheet

5 Register map



## 5 Register map

## 5.1 Register map access method

The registers that can be accessed by the user's application via the communication interfaces are covered here. Registers need to be addressed byte-wise.

Mode	Symbol	Description
Read/Write	rw	This bit or bitfield can be written or read
Read	r	This bit or bitfield is read-only
Write	w	This bit or bitfield is write-only (read as 0 <sub>H</sub> )
Read/Write hardware or firmware affected	rwh	As rw, but bit or bitfield can also be modified by hardware or firmware
Read hardware or firmware affected	rh	As r, but bit or bitfield can also be modified by hardware or firmware
Sticky	S	Bits with this attribute are "sticky" in one direction. If their reset value is overwritten once they can be switched again into their reset state only by a reset operation. Software and internal logic (except reset-like functions) cannot switch this type of bit into its reset state by writing directly to the register. The sticky attribute can be combined with other functions (for example, "rh")
Reserved/not implemented	0	<ul> <li>Bitfields named "0" indicate functions not implemented. They have the following behavior:</li> <li>Reading these bitfields returns 0<sub>H</sub></li> <li>Writing these bitfields has no effect</li> <li>These bitfields are reserved. When writing, software should always set such bitfields to 0<sub>H</sub> to preserve compatibility with future products</li> </ul>
Reserved/not defined	Res	Certain bitfields or bit combinations in a bitfield can be marked as "Reserved", indicating that the behavior of the device is undefined for that combination of bits. Setting the register to such an undefined value may lead to unpredictable results. When writing, the software must always set such bitfields to legal values

#### Table 12Bit access terminology

## PASCO2V15

Datasheet

5 Register map



## 5.2 Register map bitfields

Name	Address	7	6	5	4	3	2	1	0	Reset
			v	5		5	-	-	V	
PROD_ID	0x00	PROD			REV					0x4F
										0x60*
SENS_ST S	0x01	SEN_RDY	PWM_DI S_ST	ORTMP	ORVS	ICCER	ORTMP_ CLR	ORVS_CL R	ICCER_C LR	0xC0
MEAS_RA TE_H	0x02	0				VAL				0x00
MEAS_RA TE_L	0x03	VAL			_					0x3C
MEAS_CF G	0x04	Reserved		PWM_O UTEN	PWM_M ODE	BOC_CFG		OP_MODI	Ξ	0x24
СО2РРМ _Н	0x05	VAL								0x00
CO2PPM _L	0x06	VAL								0x00
MEAS_ST S	0x07	0		Reserved	DRDY	INT_STS	ALARM	INT_STS _CLR	ALARM_ CLR	0x00
INT_CFG	0x08	0			INT_TYP	INT_FUN	<u> </u>	ALARM_ TYP	0x11	
ALARM_T H_H	0x09	VAL								0x00
ALARM_T H_L	0x0A	VAL								0x00
PRES_RE F_H	0x0B	VAL								0x03
PRES_RE F_L	0x0C	VAL								0xF7
CALIB_R EF_H	0x0D	VAL								0x01
CALIB_R EF_L	0x0E	VAL	VAL						0x90	
SCRATCH _PAD	0x0F	VAL	VAL							0x00
SENS_RS T	0x10	SRTRG								0x00

*Note:* • Registers with addresses 0x11 to 0x14 are reserved and must not be accessed. Any read or write operation to these registers will result in a communication error.

• Registers with addresses 0x15 to 0xFF are reserved and must not be accessed. Any read or write operation to these registers will result in a non-acknowledge error.

# PASCO2V15

Datasheet

5 Register map



## 5.3 Product and revision ID register (PROD\_ID)

This register displays the device's product and version ID. Write accesses to this register are ignored.

PROD_ID Product and revision ID register			R	Address: eset value:	0x00 <sub>1</sub> 0x4F/0x60 <sub>1</sub>			
	7	6	5	4	3	2	1	0
		PROD				REV		
r						r		

Field	Bits	Туре	Description
PROD	7:5	r	Product ID
			This bitfield indicates the product type.
			001 <sub>B</sub> : Reserved
			010 <sub>B</sub> : PASCO2V01
			011 <sub>B</sub> : PASCO2V15
REV	4:0	r	Revision ID
			This bitfield indicates the product and firmware revision.
			0001 <sub>B</sub> : Revision 1.
			0010 <sub>B</sub> : Revision 2.
			0011 <sub>B</sub> : Revision 3.

## 5.4 Sensor status register (SENS\_STS)

This register displays and controls the status of the sensor. Write accesses to the read-only bits of this register are ignored.

SENS_STS Sensor status	register		R	Address: eset value:			0x01 <sub>H</sub> 0xC0 <sub>H</sub>
7	6	5	4	3	2	1	0
SEN_RDY	PWM_DIS_S T	ORTMP	ORVS	ICCER	ORTMP_CLR	ORVS_CLR	ICCER_CLR
rh	rh	rhs	rhs	rhs	w	w	w

Field	Bits	Туре	Description
SEN_RDY	7	rh	Sensor ready bit
			This bit indicates if the initialization of the sensor after power-or reset has been performed correctly.
			0 <sub>B</sub> : The sensor has not been initialized correctly.
			1 <sub>B</sub> : The sensor has been initialized correctly.

(table continues...)

5 Register map





Field	Bits	Туре	Description
PWM_DIS_ST	6	rh	PWM_DIS pin status
			This bit indicates the level read at pin <b>PWM_DIS</b> .
			0 <sub>B</sub> : A low level is read at pin <b>PWM_DIS</b> .
			1 <sub>B</sub> : A high level is read at pin <b>PWM_DIS</b> .
			<i>Note:</i> This bit is updated at every transition at pin <b>PWM_DIS</b> .
ORTMP	5	rhs	Out-of-range temperature error bit (sticky bit)
			This bit indicates if a condition where the temperature has been outside the specified valid range has been detected.
			0 <sub>B</sub> : No error has occurred.
			1 <sub>B</sub> : An error has occurred.
			This bit is cleared by setting <b>SENS_STS.ORTMP_CLR</b> .
ORVS	4	rhs	Out-of-range VDD5V error bit (sticky bit)
			This bit indicates if a condition where VDD5V has been outside the specified valid range has been detected.
			0 <sub>B</sub> : No error has occurred.
			1 <sub>B</sub> : An error has occurred.
			This bit is cleared by setting bit <b>SENS_STS.ORVS_CLR</b> .
ICCER	3	rhs	Communication error notification bit (sticky bit)
			This bit indicates if a non-valid command has been received by the serial communication interface.
			0 <sub>B</sub> : No invalid command received.
			1 <sub>B</sub> : An invalid command has been received.
			This bit is cleared by setting <b>SENS_STS.ICCER_CLR</b> .
ORTMP_CLR	2	w	Out-of-range temperature error clear bit
			Writing this bit with 1 <sub>B</sub> clears the sticky bit <b>SENS_STS.ORTMP</b> .
			This bit is read back as 0 <sub>B</sub> .
ORVS_CLR	1	w	Out-of-range VDD5V error clear bit
			Writing this bit with 1 <sub>B</sub> clears the sticky bit <b>SENS_STS.ORVS</b> .
			This bit is read back as 0 <sub>B</sub> .
ICCER_CLR	0	w	Communication error clear bit
			Writing this bit with 1 <sub>B</sub> clears the sticky bit <b>SENS_STS.ICCER</b> .
			This bit is read back as 0 <sub>B</sub> .

5 Register map



#### 5.5 Measurement period configuration registers (MEAS RATE H)

Registers MEAS\_RATE\_H and MEAS\_RATE\_L define the measurement period used in continuous mode. The concatenation of MEAS\_RATE\_H (MSB) and MEAS\_RATE\_L (LSB) define the period. The concatenated value is coded as a two's complement signed short integer (1 bit = 1 s).

Values above  $0FF_{H}$  are treated as being equal to  $FF_{H}$  (4095 s). Values below  $0005_{H}$  are treated as being equal to  $0005_{H}$  (5 s). Writing a non-valid value to this field generates a communication error (bit SENS STS.ICCER set).

#### When writing to **MEAS\_RATE\_H** and **MEAS\_RATE\_L**, the new value is not immediately considered by the Note: device. It is internally latched at the next transition from idle to continuous mode.

MEAS_RATE_H Measurement	rasurement period configuration registers		R	Address: Reset value:			0x02 <sub>H</sub> 0x00 <sub>H</sub>
7	7 6 5		4	3	2	1	0
		D			V	AL	
	r	w			r۱	vh	

Field	Bits	Туре	Description		
0	7:4	rw	Reserved		
			This bitfield shall be written with 0 <sub>H</sub> .		
VAL	3:0	rwh	MSB of the measurement period in continuous mode		
			The concatenation of this value with bitfield <b>MEAS_RATE_L</b> defines the measurement period in continuous mode.		
			<b>Note</b> : Values above 0F <sub>H</sub> reserved. Writing a non-valid value to this field generates a communication error (bit <b>SENS_STS.ICCER</b> set) and sets the bitfield to 0F <sub>H</sub> .		

#### 5.6 Measurement period configuration registers (MEAS RATE L)

Registers MEAS RATE H and MEAS RATE L define the measurement period used in continuous mode. The concatenation of MEAS\_RATE\_H (MSB) and MEAS\_RATE\_L (LSB) define the period. The concatenated value is coded as a two's complement signed short integer (1 bit = 1 s).

Values above  $0FF_{H}$  are treated as being equal to  $FF_{H}$  (4095 s). Values below  $0005_{H}$  are treated as being equal to  $0005_{H}$  (5 s). Writing a non-valid value to this field generates a communication error (bit SENS\_STS.ICCER set).

#### When writing to **MEAS\_RATE\_H** and **MEAS\_RATE\_L**, the new value is not immediately considered by the Note: device. It is internally latched at the next transition from idle to continuous mode.

MEAS_RATE_L Measurement period configuration registers				Address:		0x03 <sub>H</sub>		
			Reset value:				0x3C <sub>H</sub>	
7	6	5	4	3	2	1	0	
			V	AL				

rwh

5 Register map



Field	Bits	Туре	Descript	ion
VAL	7:0	rwh	LSB of t	ne measurement period in continuous mode
				catenation of this value with bitfield <b>MEAS_RATE_H.VAL</b> he measurement period in continuous mode.
			Note:	Values 00 <sub>H</sub> to 04 <sub>H</sub> are reserved. Writing a non-valid value to this field generates a communication error (bit <b>SENS_STS.ICCER</b> set) and sets the bitfield to 05 <sub>H</sub> .

# 5.7 Measurement mode configuration register (MEAS\_CFG)

This register defines the operation settings of the device.

MEAS	MEAS_CFG				Address:	0x04 <sub>H</sub>		
Meas	Measurement mode configuration register			Reset value:			0x24 <sub>H</sub>	
	7	6	5	4	3	2	1	0
	Res		PWM_OUTE N	PWM_MODE	BOC_	_CFG	OP_M	IODE
	rwh		rwh	rw	rw	/h	rw	h

Field	Bits	Туре	Description
Res	7:6	rwh	Reserved
			This bitfield shall be written with 00 <sub>B</sub> .
PWM_OUTEN	5	rwh	PWM output software enable bit
			0 <sub>B</sub> : <b>PWM</b> output is disabled by software.
			1 <sub>B</sub> : <b>PWM</b> output is enabled by software.
			Notes:
			1. The actual state of pin PWM depends on both MEAS_CFG.PWM_OUTEN and pin PWM_DIS.
			<b>2.</b> This bit is automatically set at a high to low transition at pin
			PWM_DIS.
 PWM_MODE	4	rw	PWM mode configuration
			0 <sub>B</sub> : PWM single-pulse mode.
			1 <sub>B</sub> : PWM pulse-train mode.

### (table continues...)

5 Register map



#### (continued)

Field	Bits	Туре	Descriptio	on
BOC_CFG	3:2	rwh	Baseline o	offset compensation configuration
			00 <sub>B</sub> : Auton	natic baseline offset compensation (ABOC) disabled.
			01 <sub>B</sub> : ABOC computati	enabled. The offset is periodically updated at each BOC on.
			Note:	With firmware version 2.18 an extended ABOC functionality has been introduced, including support for single shot mode.
			10 <sub>B</sub> : Force	d compensation.
			Note:	After the forced compensation is done, device automatically reconfigures itself into ABOC ( <b>MEAS_CFG.BOC_CFG</b> = 01 <sub>B</sub> ).
			11 <sub>B</sub> : Reserv	ved.
OP_MODE	1:0	rwh	Sensor op	erating mode
			00 <sub>B</sub> : Idle m	node.
				e-shot mode enabled. Writing 01 <sub>B</sub> to this field triggers a asurement sequence. This field is reset by firmware ally.
			10 <sub>B</sub> : Contir	nuous mode enabled.
			11 <sub>B</sub> : Reserv	ved (as 00 <sub>B</sub> ).

## 5.8 CO<sub>2</sub> concentration result register (CO2PPM\_H)

Registers **C02PPM\_H** and **C02PPM\_L** are used to display the result of the last CO<sub>2</sub> concentration measurement. The concatenation of **C02PPM\_H** (MSB) and **C02PPM\_L** (LSB) define the CO<sub>2</sub> concentration value. The concatenated CO<sub>2</sub> concentration value is coded as a two's complement signed short integer (1 bit = 1 ppm). This field is updated at the end of each measurement sequence.

Reading register CO2PPM\_L clears bit MEAS\_STS.DRDY.

When reading the CO<sub>2</sub> concentration value, the user shall first read registers CO2PPM\_H and then CO2PPM\_L.

	O2PPM_H O <sub>2</sub> concentrat	tion result regi	ster	Address: Reset value:			0x05 <sub>H</sub> 0x00 <sub>H</sub>	
7 6 5		5	4	3	2	1	0	
				V	AL			
				r	'n			

 
 Field
 Bits
 Type
 Description

 VAL
 7:0
 rh
 MSB of the CO<sub>2</sub> concentration value The concatenation of this value with bitfield CO2PPM\_L.VAL gives the CO<sub>2</sub> concentration value.
 \_\_\_\_\_

5 Register map



## 5.9 CO<sub>2</sub> concentration result register (CO2PPM\_L)

Registers **C02PPM\_H** and **C02PPM\_L** are used to display the result of the last CO<sub>2</sub> concentration measurement. The concatenation of **C02PPM\_H** (MSB) and **C02PPM\_L** (LSB) define the CO<sub>2</sub> concentration value. The concatenated CO<sub>2</sub> concentration value is coded as a two's complement signed short integer (1 bit = 1 ppm). This field is updated at the end of each measurement sequence.

### Reading register CO2PPM\_L clears bit MEAS\_STS.DRDY.

When reading the CO<sub>2</sub> concentration value, the user shall first read registers **CO2PPM\_H** and then **CO2PPM\_L**.

	CO2PPM_L CO <sub>2</sub> concentra	tion result regi	ster	Address: Reset value:				0x06 <sub>H</sub> 0x00 <sub>H</sub>
_	7	6	5	4	3	2	1	0
				VA	AL.			
				r	h			

Field	Bits	Туре	Description
VAL	7:0	7:0 rh	LSB of the CO <sub>2</sub> concentration value
			The concatenation of this value with bitfield <b>CO2PPM_H.VAL</b> gives the $CO_2$ concentration value.
			Reading this bitfield clears bit <b>MEAS_STS.DRDY</b> .

## 5.10 Measurement status register (MEAS\_STS)

This register displays the status information of the sensor. Write accesses to the read-only bits of this register are ignored.

M	7 6 5				Address:	0x		
Me	Measurement status register			F	leset value:		0x00 <sub>H</sub>	
	7	6	5	4	3	2	1	0
	0		Res	DRDY	INT_STS	ALARM	INT_STS_CL R	ALARM_CLR
	rw	I	rh	rhs	rhs	rhs	w	w

Field	Bits	Туре	Description
0	7:6	rw	Reserved
			This bitfield is read as 00 <sub>B</sub> .
Res	5	rh	Reserved
			This bit is reserved.
DRDY	4	rhs	Data ready bit (sticky bit)
			This bit indicates if new data are available in register <b>CO2PPM_H</b> and <b>CO2PPM_L</b> .
			0 <sub>B</sub> : No new data are available.
			1 <sub>B</sub> : Unread data are available. This bit is set at the end of every measurement sequence.
			This bit is cleared by reading <b>CO2PPM_L</b> .

#### (table continues...)

\_\_\_\_\_

5 Register map



### (continued)

Field	Bits	Туре	Description
INT_STS	3	rhs	INT pin status bit
			This bit indicates if pin <b>INT</b> has been latched to active state (in case of alarm or data ready).
			0 <sub>B</sub> : Pin <b>INT</b> has not been latched to active state.
			1 <sub>B</sub> : Pin <b>INT</b> has been latched to active state. This bit is set at the end of every measurement sequence in case of a latching condition.
			This bit is cleared by setting bit <b>MEAS_STS.INT_STS_CLR</b> .
ALARM	2	rhs	Alarm notification (sticky bit)
			This bit indicates if a threshold violation occurred.
			0 <sub>B</sub> : No violation occurred.
			1 <sub>B</sub> : Violation occurred. This bit is set at the end of every measurement sequence in case of violation.
			This bit is cleared by setting bit <b>MEAS_STS.ALARM_CLR</b> .
INT_STS_CLR	1	w	INT pin status clear bit
			Writing this bit with $1_B$ clears the sticky bit <b>MEAS_STS.INT_STS</b> and forces pin <b>INT</b> to inactive level.
			This bit is read back as 0 <sub>B</sub> .
ALARM_CLR	0	w	Alarm notification clear bit
			Writing this bit with $1_B$ clears the sticky bit <b>MEAS_STS.ALARM</b> .
			This bit is read back as 0 <sub>B</sub> .

## 5.11 Interrupt pin configuration register (INT\_CFG)

This register defines the configuration of pin **INT**.

INT_CFG				Address:		0x08 <sub>H</sub>	
Interrupt pin configuration register			Reset value:				0x11 <sub>H</sub>
7	6	5	4	3	2	1	0
	0		INT_TYP		INT_FUNC		ALARM_TYP
	rw		rw		rw		rw

Field	Bits	Туре	Description
0	7:5	rw	Reserved
			This bitfield shall be written with 00 <sub>B</sub> .
INT_TYP	4	rw	Pin INT electrical configuration
			0 <sub>B</sub> : Pin <b>INT</b> is configured as push-pull and low active.
			1 <sub>B</sub> : Pin <b>INT</b> is configured as push-pull and high active.
			<b>Note</b> : Writing this bitfield forces pin <b>INT</b> to inactive state

(table continues...)

5 Register map



#### (continued)

Field	Bits	Туре	Description
INT_FUNC	3:1	rw	Pin INT function configuration
			000 <sub>B</sub> : Pin <b>INT</b> is inactive.
			$001_{\rm B}$ : Pin <b>INT</b> is configured as alarm threshold violation notification pin.
			010 <sub>B</sub> : Pin <b>INT</b> is configured as data ready notification pin.
			011 <sub>B</sub> : Pin <b>INT</b> is configured as sensor busy notification pin.
			100 <sub>B</sub> : Pin <b>INT</b> is configured as early measurement start notification pin (this function only is available in continuous mode with <b>MEAS_CFG.OP_MODE</b> = 10 <sub>B</sub> , otherwise the pin is inactive).
			101 <sub>B</sub> : Reserved
			111 <sub>B</sub> : Reserved
ALARM_TYP	0	rw	Alarm type configuration bit
			This bitfield defines if an alarm is issued in case of lower or higher threshold violation.
			0 <sub>B</sub> : Crossing down – the concatenated value of register <b>ALARM_TH_H</b> and <b>ALARM_TH_L</b> is defined as a lower threshold register.
			1 <sub>B</sub> : Crossing up – the concatenated value of register <b>ALARM_TH_H</b> and <b>ALARM_TH_L</b> is defined as a higher threshold register.

## 5.12 Alarm threshold register (ALARM\_TH\_H)

Registers **ALARM\_TH\_H** and **ALARM\_TH\_L** define the value used as a threshold for the alarm violation. The concatenation of **ALARM\_TH\_H** (MSB) and **ALARM\_TH\_L** (LSB) define the threshold value that shall be considered by the device. The concatenated alarm threshold value is coded as a 2's complement signed short integer (1 bit = 1 ppm).

ALARM_TH_H Alarm threshold register				Address: Reset value:			0x09 0x00		
7				4	3	2	1	0 0,000H	
	VAL								
				n	v				

Field	Bits	Туре	Description
VAL	7:0	rw	MSB of the alarm threshold
			The concatenation of this value with bitfield <b>ALARM_TH_L.VAL</b> defines the threshold value.

5 Register map



## 5.13 Alarm threshold register (ALARM\_TH\_L)

Registers **ALARM\_TH\_H** and **ALARM\_TH\_L** define the value used as a threshold for the alarm violation. The concatenation of **ALARM\_TH\_H** (MSB) and **ALARM\_TH\_L** (LSB) define the threshold value that shall be considered by the device. The concatenated alarm threshold value is coded as a 2's complement signed short integer (1 bit = 1 ppm).

ALARM_TH_L Alarm threshold register				Address: Reset value:			0x0A <sub>F</sub> 0x00 <sub>F</sub>		
7 6 5			4	3 VAL		2 1	0		
				rw					

Field	Bits	Туре	Description
VAL	7:0	rw	LSB of the alarm threshold
			The concatenation of this value with bitfield <b>ALARM_TH_H.VAL</b> defines the threshold value.

## 5.14 Pressure compensation registers (PRES\_REF\_H)

Registers **PRES\_REF\_L** and **PRES\_REF\_H** are used to capture the atmospheric pressure to be compensated. The concatenation of **PRES\_REF\_H** (MSB) and **PRES\_REF\_L** (LSB) define the pressure value that shall be considered by the device. The concatenated pressure value is coded as an unsigned short integer (1 bit = 1 hPa). Since even small variations of the external pressure may lead to significant changes in the output provided by the sensor, it must be ensured that a coherent value is available for the sensor. For that purpose, **PRES\_REF\_H** and **PRES\_REF\_L** are associated with two internal shadow registers from which the device reads the pressure value to be used by the internal firmware. When writing to **PRES\_REF\_L**, the complete 16-bit pressure value is loaded into the shadow registers. When writing to **PRES\_REF\_H**, the shadow registers are not updated. Therefore, to update the pressure value, the user has to write first **PRES\_REF\_H** and then **PRES\_REF\_L**.

Pressure compensation is de facto deactivated if the default value is not updated.

For correct operation, the user shall ensure that pressure value programmed is within the specified pressure operating range of the device. The valid range of operation is 750 hPa to 1150 hPa.

Values below 750 hPa will be treated as 750 hPa (register automatically updated). Similarly, values above 1150 hPa will be treated at 1150 hPa (register automatically updated). If a value outside this range is written, bit **SENS\_STS.ICCER** is set.

PRES_REF_H			Address:			0x0B <sub>H</sub>		
Pressure compensation registers			Reset value:			0x03 <sub>H</sub>		
7	7 6 5		4	3	2	1	0	
	VAL							
			rv	vh				

Field	Bits	Туре	Description
VAL	7:0	rwh	MSB of the pressure compensation value
			The concatenation of this value with bitfield <b>PRESS_REF_L.VAL</b> gives the pressure compensation value.

Datasheet

5 Register map



## 5.15 Pressure compensation registers (PRES\_REF\_L)

Registers **PRES\_REF\_L** and **PRES\_REF\_H** are used to capture the atmospheric pressure to be compensated. The concatenation of **PRES\_REF\_H** (MSB) and **PRES\_REF\_L** (LSB) define the pressure value that shall be considered by the device. The concatenated pressure value is coded as an unsigned short integer (1 bit = 1 hPa). Since even small variations of the external pressure may lead to significant changes in the output provided by the sensor, it must be ensured that a coherent value is available for the sensor. For that purpose, **PRES\_REF\_H** and **PRES\_REF\_L** are associated with two internal shadow registers from which the device reads the pressure value to be used by the internal firmware. When writing to **PRES\_REF\_L**, the complete 16-bit pressure value is loaded into the shadow registers. When writing to **PRES\_REF\_H**, the shadow registers are not updated. Therefore, to update the pressure value, the user has to write first **PRES\_REF\_H** and then **PRES\_REF\_L**.

Pressure compensation is de facto deactivated if the default value is not updated.

For correct operation, the user shall ensure that pressure value programmed is within the specified pressure operating range of the device. The valid range of operation is 750 hPa to 1150 hPa.

Values below 750 hPa will be treated as 750 hPa (register automatically updated). Similarly, values above 1150 hPa will be treated at 1150 hPa (register automatically updated). If a value outside this range is written, bit **SENS\_STS.ICCER** is set.

PRES_REF_L			Address:			0x0C <sub>H</sub>		
Pressure compensation registers			Reset value:			0xF7 <sub>H</sub>		
_	7 6 5		4	3	2	1	0	
	VAL							
				rv	vh			

Field	Bits	Туре	Description
VAL 7:0 rwh		rwh	LSB of the pressure compensation value
			The concatenation of this value with bitfield <b>PRESS_REF_H.VAL</b> gives the pressure compensation value.

## 5.16 Automatic baseline offset compensation reference (CALIB\_REF\_H)

Registers **CALIB\_REF\_H** and **CALIB\_REF\_L** define the reference value used for the ABOC and the force calibration. The concatenation of **CALIB\_REF\_H** (MSB) and **CALIB\_REF\_L** (LSB) define the reference value. The concatenated offset value is coded as a two's complement signed short integer (1 bit = 1 ppm).

Values must be comprised between 350 ppm and 1500 ppm. Values below 350 ppm will be treated as 350 ppm (register automatically updated). Similarly, values above 1500 ppm will be treated at 1500 ppm (register automatically updated). If a value outside this range is written, bit **SENS\_STS.ICCER** is set.

CALIB_REF_H				Address:			0x0D <sub>H</sub>
Automatic bas reference	eline offset cor	npensation	R	eset value:			0x01 <sub>H</sub>
7	6	5	4	3	2	1	0
			V	AL			
			rv	vh			

Field	Bits	Туре	Description
VAL	7:0	rwh	MSB of the ABOC
			The concatenation of this value with bitfield <b>CALIB_REF_L.VAL</b> gives the currently used reference value.

5 Register map



## 5.17 Automatic baseline offset compensation reference (CALIB\_REF\_L)

Registers **CALIB\_REF\_H** and **CALIB\_REF\_L** define the reference value used for the ABOC and the force calibration. The concatenation of **CALIB\_REF\_H** (MSB) and **CALIB\_REF\_L** (LSB) define the reference value. The concatenated offset value is coded as a two's complement signed short integer (1 bit = 1 ppm).

Values must be comprised between 350 ppm and 1500 ppm. Values below 350 ppm will be treated as 350 ppm (register automatically updated). Similarly, values above 1500 ppm will be treated at 1500 ppm (register automatically updated). If a value outside this range is written, bit **SENS\_STS.ICCER** is set.

CALIB_REF_L				Address:			0x0E <sub>H</sub>
Automatic bas reference	eline offset cor	npensation	R	eset value:			0x90 <sub>H</sub>
7	6	5	4	3	2	1	0
			VA	AL			
			rw	<i>v</i> h			

Field	Bits	Туре	Description
VAL	7:0	rwh	LSB of the ABOC
			The concatenation of this value with bitfield <b>CALIB_REF_H.VAL</b> gives the currently used reference value.

## 5.18 Scratch pad register (SCRATCH\_PAD)

This register provides a readable and writable address space for data integrity test during runtime. This register is not associated with a specific hardware functionality.

SCRATCH_F	PAD			Address:			0x0F <sub>H</sub>
Scratch pac	l register		R	eset value:			0x00 <sub>H</sub>
7	6	5	4	3	2	1	0
			V	AL			
			r	N			

Field	Bits	Туре	Description
VAL	7:0	rw	Read/Write value
			This bit field is "don't care" for the device.

# PASCO2V15

Datasheet

5 Register map



# 5.19 Soft reset register (SENS\_RST)

This register is used to trigger a soft reset.

In case an invalid command is received, bit **SENS\_STS.ICCER** is set.


SE	NS_RST				Address:			0x10 <sub>H</sub>
So	ft reset regis	ter		R	eset value:			0x00 <sub>H</sub>
	7	6	5	4	3	2	1	0
				SRI	ſRG			
				v	v			

Field	Bits	Туре	Description
SRTRG	7:0	w	Soft reset trigger
			Writing A3 <sub>H</sub> to this field triggers a soft reset event.
			Writing BC <sub>H</sub> to this field resets the ABOC context.
			Writing CD <sub>H</sub> to this field disables the advanced VDD compensation feature.
			Writing CF <sub>H</sub> to this field saves the force calibration offset immediately in the internal non-volatile memory.
			Writing DF <sub>H</sub> to this field disables the Stepwise Reactive IIR Filter.
			Writing $FC_H$ to this field resets the forced compensation correction factor.
			Writing FE <sub>H</sub> to this field enables the Stepwise Reactive IIR Filter (by default enabled).
			Other values are reserved. Writing a non-valid value to this field generates a communication error (bit <b>SENS_STS.ICCER</b> set).
			This bit is read back as 00 <sub>H</sub> .

6 Assembly instruction

## 6 Assembly instruction

XENSIV<sup>™</sup> PAS CO2 module is classified as moisture-sensitivity level 3 (MSL 3). The maximum reflow temperature during board assembly must not exceed 245°C according to IPC/JEDEC J-STD-020E. As shown in the Figure 11, pad 1 to 14 need to be soldered. Pad 1 to 10 need to be assembled as per functionality (Table 1). Pad 11 and 13 need to be connected to the GND. Pad 12 and 14 are not internally connected but must be soldered to maintain mechanical stability. Pad 12 and 14 can be left open or connected to GND. Non-marked smaller pads should be kept open.

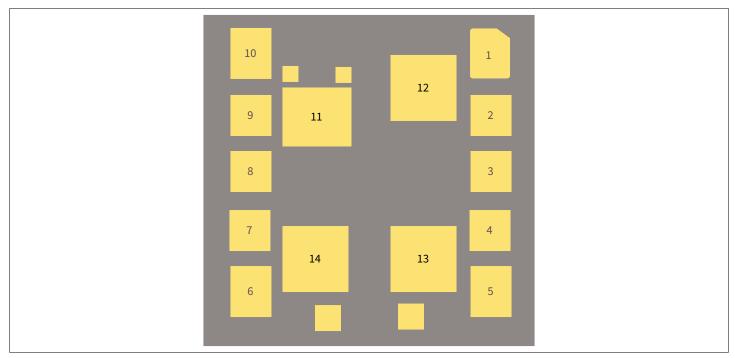

### Figure 11 XENSIV<sup>™</sup> PASCO2V15 pads need to be connected to an application board

### Notes:

- 1. One-time reflow is permitted and after assembly rework is not recommended
- 2. Vapor phase soldering may damage the sensor irreversibly

For the customer, the allocated floor time (out of bag) is 168 hours (at ≤30°C and 60% r.H.) according to IPC/JEDEC J-STD-020. If floor time exceeds, then the parts (out of moisture barrier bag) need to be baked according to the following table:

### Table 14Baking condition of the XENSIV™ PASCO2V15


Package condition	Bake temperature	Bake time	Condition
Sensors outside of tape	125°C	24 hours	r.H. < 5%
Sensors within the tape	40°C	8 days	r.H. < 5%

7

7 Package dimensions and footprint



Package dimensions and footprint

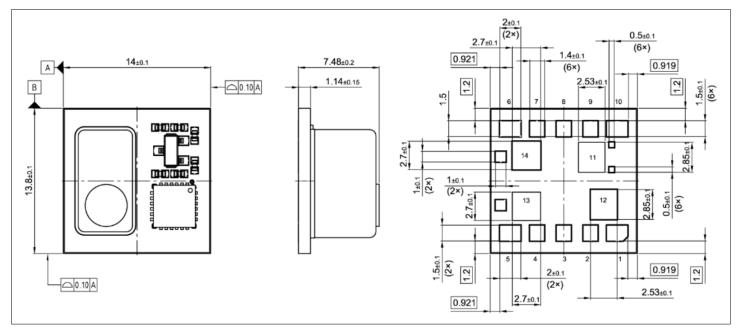




Package outline (top, side, and bottom view of LG-MLGA-14-2)



8 Packing for shipment

## 8 Packing for shipment

The device will be shipped in tape and reel. Each tape and reel consist of 300 parts.

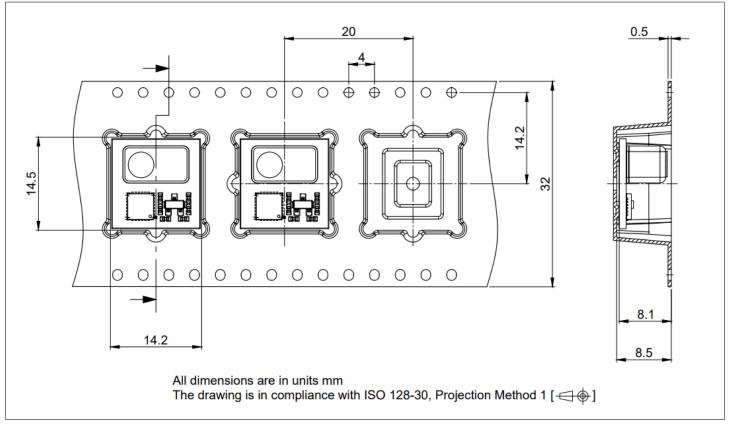



## PASCO2V15

Datasheet

Revision history



# **Revision history**

Document revision	Date	Description of changes
1.0	2024-02-20	Initial release
1.1	2024-03-06	Halogen-free and RoHS symbol and storage time added/updated
1.2	2024-06-05	Updated list of target applications
1.3	2024-11-27	Added Sections 5 to 8
_		Updated datasheet template

#### Trademarks

All referenced product or service names and trademarks are the property of their respective owners.

Edition 2024-11-27 Published by Infineon Technologies AG 81726 Munich, Germany

© 2024 Infineon Technologies AG All Rights Reserved.

Do you have a question about any aspect of this document? Email: erratum@infineon.com

Document reference IFX-klv1724056744187

#### Important notice

The information given in this document shall in no event be regarded as a guarantee of conditions or characteristics ("Beschaffenheitsgarantie").

With respect to any examples, hints or any typical values stated herein and/or any information regarding the application of the product, Infineon Technologies hereby disclaims any and all warranties and liabilities of any kind, including without limitation warranties of non-infringement of intellectual property rights of any third party.

In addition, any information given in this document is subject to customer's compliance with its obligations stated in this document and any applicable legal requirements, norms and standards concerning customer's products and any use of the product of Infineon Technologies in customer's applications.

The data contained in this document is exclusively intended for technically trained staff. It is the responsibility of customer's technical departments to evaluate the suitability of the product for the intended application and the completeness of the product information given in this document with respect to such application.

#### Warnings

Due to technical requirements products may contain dangerous substances. For information on the types in question please contact your nearest Infineon Technologies office.

Except as otherwise explicitly approved by Infineon Technologies in a written document signed by authorized representatives of Infineon Technologies, Infineon Technologies' products may not be used in any applications where a failure of the product or any consequences of the use thereof can reasonably be expected to result in personal injury.